

Date: Monday, 1/14/2008 2:29:37 PM  
 User: Kim Johnston

## Process Sheet

5

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKIDTUBE ASSEMBLY  
 Job Number : 36717  
 Estimate Number : 10022  
 P.O. Number :  
 This Issue : 1/14/2008 S.O. No. :  
 Prsht Rev. : NC Part Number : D205634011  
 First Issue : 1 / 1 Type : LANDING GEAR Drawing Number : N/A  
 Previous Run : 36716 Drawing Revision : N/A  
 Material :  
 Due Date : 1/31/2008 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By : JA 08 01 15  
 Comment : Est Rev:P 02.08.28 Removed QC5 from Step 5 KJ

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



08.01.22 <sup>KJ</sup> (1)

Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D205-634-011 CHG005

Drop

2.0 36717A SKID TUBE ASSEMBLY



Comment: Sub-Component SKID TUBE ASSEMBLY

D205-634-041 B 36717 A

- SP

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0 K10003 D205-634-011 Saddle Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 K10003 Saddle Kit

1536308

SP

5.0 QC4 INSPECT 100% KITS FOR COMPLETENESS



(1)

Comment: INSPECT 100% KITS FOR COMPLETENESS

Drop

6.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-011

Location: Drop

JA 8/2/08 (1) SP

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 28/02/12

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/14/2008 2:29:37 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 36717

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

*Handwritten:* 12/02/12 (1)

Job Completion



*Handwritten:* mi 2008/12/12 (1)  
u

36717 A

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

5

Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

# Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY  
Job Number : 36717A  
Estimate Number : 10023  
P.O. Number :  
This Issue : 1/14/2008 S.O. No. :  
Prsht Rev. : NC Part Number : D205634041  
First Issue : 1/1 Type : LANDING GEAR Drawing Number : D2580 REV D  
Previous Run : 36716A Drawing Revision : D  
Material :  
Due Date : 1/31/2008 Qty: 1 Um: Each  
Written By :  
Checked & Approved By : 08 01 14  
Comment : Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ  
Est Rev. O 06.02.28 Added paperwork EC  
Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG002

NA

2.0 D25001190 Ext'n -I' Beam Tube 4"



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2500-1-190 Skid Tube Extrusion B29602

a.m 08.01.15 (1)

3.0 D2596 205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2596 205 Web 36803 SL 8-1-17

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage a.m 08.01.15 (1)

2-Cut D2500-1-190 per Dwg D2580 if necessary Debur ends a.m 08.01.15 (1)

3-Acid etch and Alodine tube per QSI 005 4.1 a.m 08.01.15 (1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36717A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*JP 8-1-16*

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

*am 08.01.16 ①*

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

*am 08.01.16 ①*

3-Countersink holes as per Dwg D2580without cutting fluid

*am 08.01.16 ①*

4-Deburr and blow out all chips from inside of tube

*am 08.01.16 ①*

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 105469

Sikaflex expire date: 8-30-1

Start Time: 1:15 Date: 8-1-17

Fin Time: 11:40 Date: 8-1-21

*SL 8-1-17*

7.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

*EL/IR 8-1-21*

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

*SL 8-1-21*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries



Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36717A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 08/01/22

10.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2576-3

Step

B33321-1

BE 08/01/31

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

B36326

BE 08/01/22

12.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m106390

BE 08/01/31

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m106390

BE 08/01/22

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

a.m 08.01.23 ①

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Deburr

a.m 08.01.23 ①

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

a.m 08.01.23 ①

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Deburr

a.m 08.01.23 ①

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

a.m 08.01.23 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36717A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 08-02-01 (1)

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/02/01 (40)

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M. 08/02/04 (1X)

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 106379

M. 08/02/05 (1X)

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BR 08-02-06 (1) ...

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B 35663

BR.

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M 100188

BR.

20.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M 104885

BR.

BR 08-02-06 (1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36717A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

21.0

ALS71032130

Insert



ALS 41032130

2008/2/11



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

Insert

Batch: M 105729

BR

22.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

BOLT

Batch: M 106574

BR

23.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

washer

Batch: M 107008

BR

24.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B 32744

BR

25.0

D35665

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B 36526

BR

26.0

D35661

GASKET



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

Batch: B 36934

BR

27.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch: B 36337

BR

BR 08-02-06

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36717A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34805

BR

29.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B36637

BR

30.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B36338

BR

31.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B36338 27168

BR

32.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B27168 96327

BR

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

Sikaflex expire date: 08-07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

BR 08-02-05

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: 12 Date: 8/24/12

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries



Date: Monday, 1/14/2008 2:29:59 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36717A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date:

M105585  
08-07

BL 08-02-05 (1)

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch:

M106894

M-1

08/02/06

(1X)

34.0

QC5

INSPECT WORK TO CURRENT STEP



08/02/07



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

DDP 36717

8/1/8 50 (1X)

36.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

DDP 08/02/12 (1)

Job Completion



mi 2008/2/11

(1)

W

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

**NOTE:** Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

**RELEASED**  
07-06-28 *[Signature]*

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

**GENERAL NOTES:**


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER RETURN TO FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
SEE NOTES ON  
PAGE 2 FOR D2580-041 AND  
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF NO. TUBE) AFTER FINISH (16 PLACES).

SHOP COPY  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
36717A


**Copyright © 1996 by DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

**DETAIL A**  
SCALE 5:24

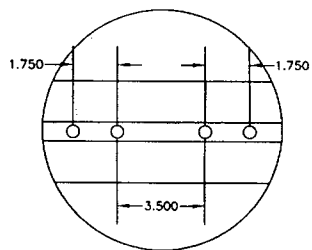


**DETAIL B**  
SCALE 5:24

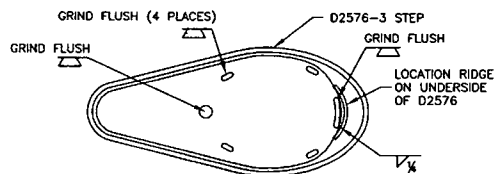


**RELEASED**  
07-06-28-4

**DETAIL C**  
SCALE 5:24

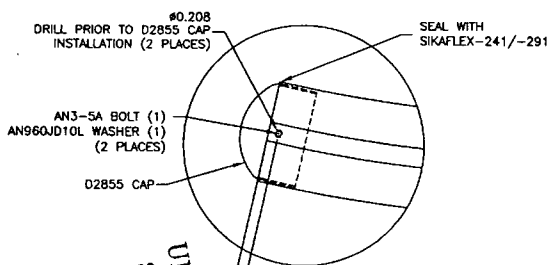


**SECTION D-D**  
SCALE 5:24

 


AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:  
1. CHAMFER HOLE 0.050 X 45°  
2. INSERT D2579 SPACER (20 PLACES)  
3. WELD INTO PLACE AND GRIND FLUSH  
4. C-BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP


**D2580-1 DRILLING DETAIL**

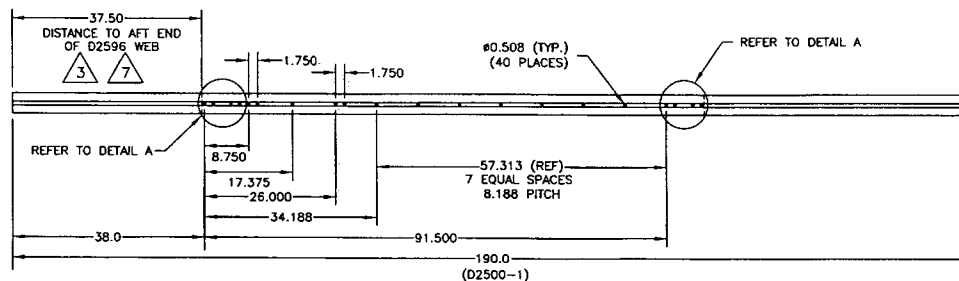

**D2580-1 BENDING AND CUTTING DETAIL**

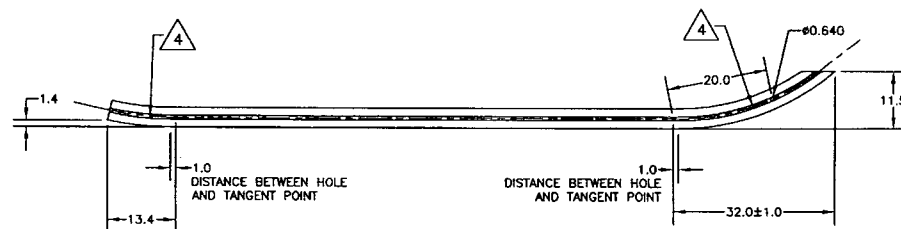

**D2580-041 ASSEMBLY DETAIL**

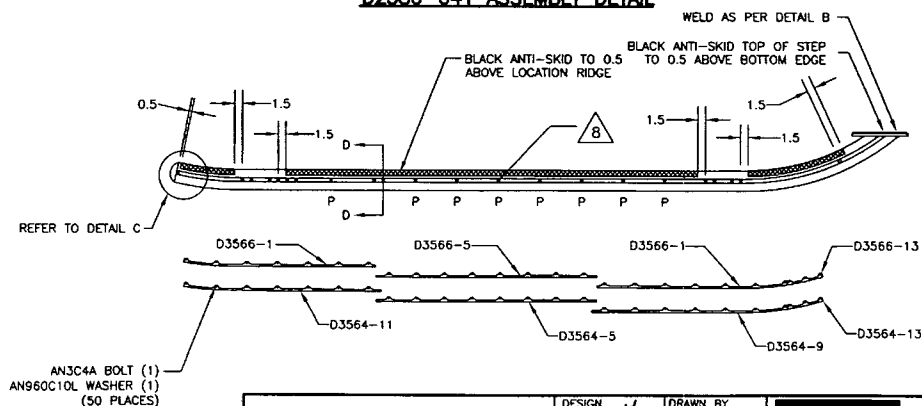

**D2580-041 NOTES**

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	<b>DART</b>	DART AEROSPACE LTD.
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE	07.02.27	D2580	SHEET 2 OF 3
		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24

Diagram illustrating the grinding locations on a propeller cross-section:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

RELEASED  
07-06-28

Diagram illustrating the rear view of the engine cover assembly. The diagram shows the following components and their installation locations:

- #0.208 DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)**: Two small circles indicate the locations for drilling holes.
- SEAL WITH SIKAFLEX-241/-291**: A dashed line indicates the location of the seal.
- AN3-SA BOLT (1)**: A single bolt is shown being installed into the cover.
- AN960JD10L WASHER (1) (2 PLACES)**: Two washers are shown being installed into the cover.
- D2855 CAP**: The cap is shown being installed onto the cover.
- SEE NOTE ii)**: A reference to a note regarding the seal application.

D2579 SPACER

WEB (REF)

1.70 (REF)

AFTER PERF

1. CHA
2. INS
3. WE

- AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D2579 SPACER (20 PLACES)
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION


[illegible]

(MAKE FROM D2580-1 DRILLING DETAIL)

Technical drawing of a curved pipe section. The drawing shows a horizontal pipe with a curved section. Key dimensions and callouts include:

- Overall length: 51.340
- Distance from left end to first hole: 5.985
- Distance between holes: 5.338 (REF)
- Distance from second hole to end of curve: 39.580
- Distance from end of curve to right end: 5.915
- Hole diameter:  $\phi 0.508$  (8 PLACES)
- Radius of curve: 20.0
- End hole diameter:  $\phi 0.640$
- Distance between hole and tangent point (left): 1.0
- Distance between hole and tangent point (right): 1.0
- Overall distance between tangent points: 32.0  $\pm$  1.0
- Left end offset: 1.4
- Right end offset: 1.1
- Callout 4: Points to the left end, the curve, and the right end.

 [illegible]

COPYRIGHT © 1986 BY DART AEROSPACE LTD.		DESIGN RH	DRAWN BY RH	 <b>DART AEROSPACE LTD.</b> HAWKESBURY, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED H	APPROVED H	DRAWING NO. D2580	REV. D SHEET 3 OF 3
DATE 07.02.27	TITLE 205 SKIDTUBE ASSEMBLY			SCALE 1:24	

NO. 141

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Bazley E.  
Joint Welding Procedure GTAW  
Part number and Job number D 305 634 011 / B367214

TEST WELDS REQUIRED

BASE METAL Aluminium WELDING PROCESS TIG  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 02-02-01 Qualifier Pat Nival